


# Service News




## Prevention of F.O. Solenoid Valve Installation Mistake

There was serious accident before that Normally Open (N.O.) and Normally Close (N.C.) was installed wrongly on type HB boiler at F.O. solenoid valve replacement. Although name plate is printed in both of Japanese and English, there are some cases that it can not be distinguished because coil part with name plate is taken off at installation and replacement, or difference of appearance can not be noticed and it is installed wrongly.

As prevention of these trouble, body of Normally Open (N.O.) is painted **Red** to distinguish Normally Open (N.O.) and Normally Close (N.C.) on valve side.

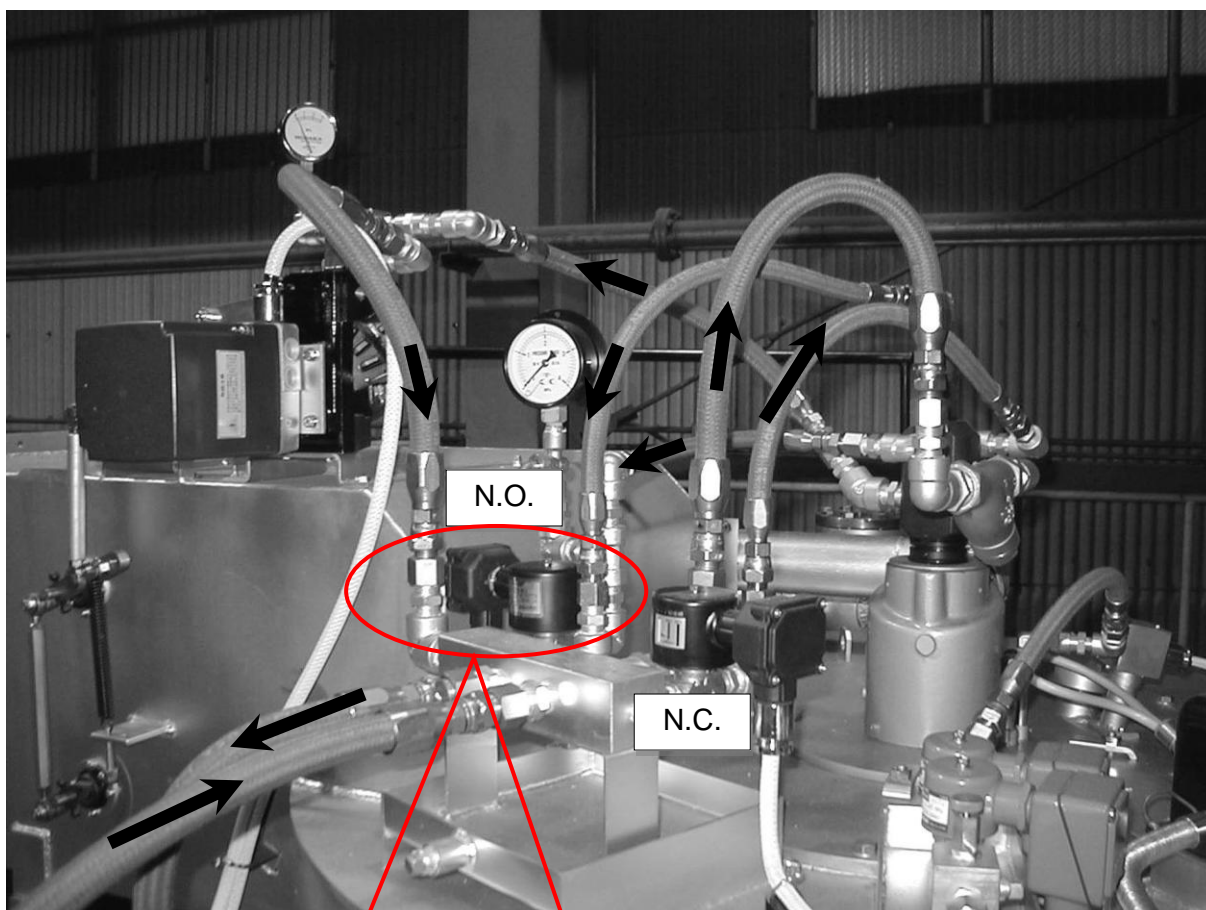

**Solenoid valve of Normally Open (N.O.) is painted red.**

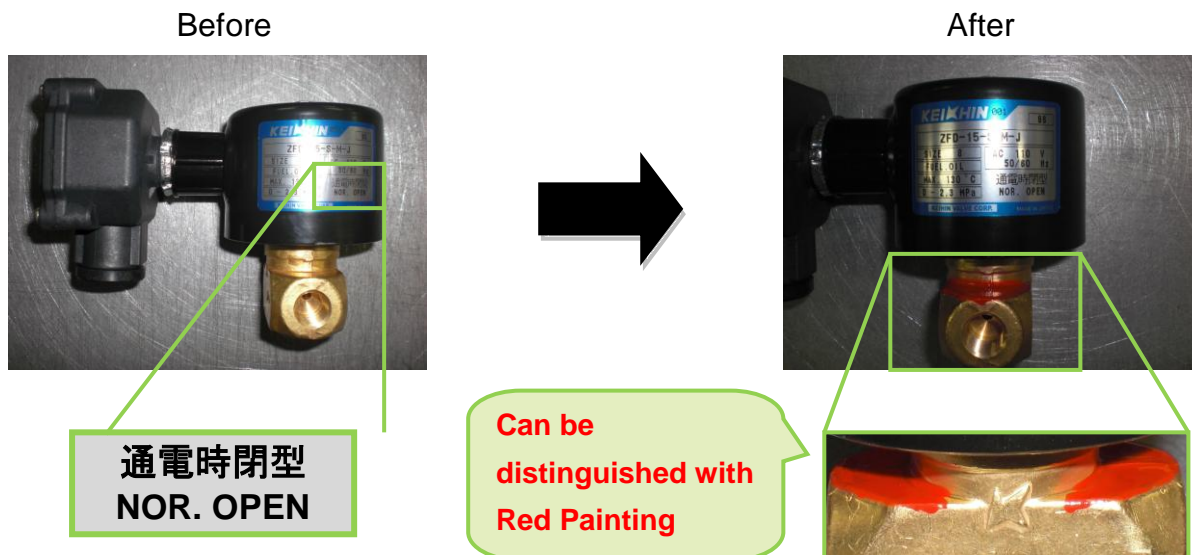

Solenoid Valve Type	Old Parts Code	New Parts Code	Power Supply
ZFD-15-S-M-J	0000-000-H853-0	0000-AKD-0613-0	AC110V
	0000-AA7-0704-0	0000-AKD-0614-0	AC220V

※Solenoid Valve (Type;ZFD-15-H-J) of Normally Close (N.C.) has no change.

We would like you to order spare parts with new parts code.

If you could have any queries on this news letter, please contact Miura Ship Machinery Dept., Maintenance Div.

**MIURA Co., Ltd.**

Ship Machinery Dept.

Maintenance Div.

TEL +81-89-979-7066

FAX +81-89-979-7067

E-mail: hakuyo\_mka@miuraz.co.jp

Shimanami Maintenance Div.

TEL +81-84-930-0740

FAX +81-84-930-0741

hakuyoshimanamimka\_ippan@miuraz.co.jp

Tokyo Maintenance Div.

TEL +81-3-5793-1047

FAX +81-3-5793-1045

Kyushu Maintenance Div.

TEL +81-92-432-3277

FAX +81-92-432-3278

New open!  
at Fukuoka city  
on April 1, 2009.

All Right Reserved, Copyright (C) 2009, MIURA Co.,Ltd.